

## Driver Installation Under Win ME

1. **Step 1:** Plug in the USB type A receptacle of the cable to the USB connector of your computer.

**Step 2:** Place the enclosed CD Driver into the CD ROM.

**Step 3:** Click “next” at the Add New Hardware Wizard screen.

See Figure 1



Figure 1

2. Please select the driver that matches your language and device and click “OK”.

See Figure 2

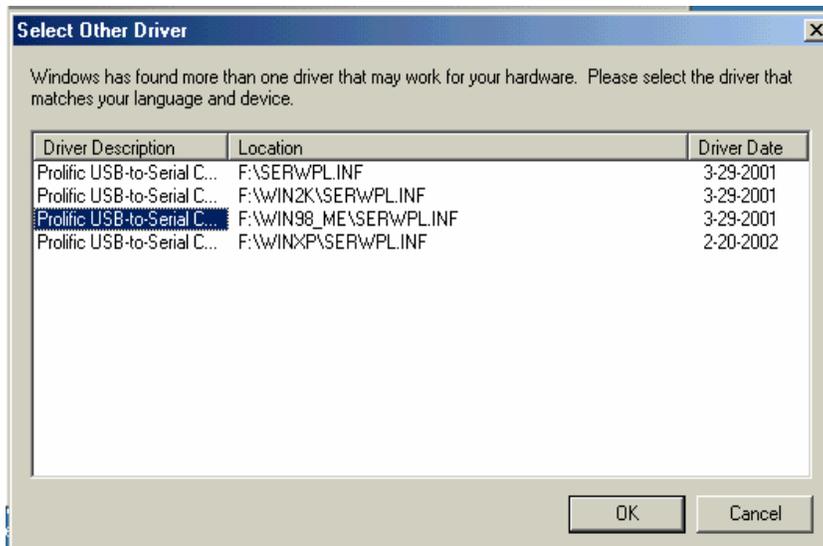


Figure 2

3. Windows has finished installing the software your new hardware device requires, click “**Finish**” to close the Wizard. See Figure 3



Figure 3

4. Double click “My Computer” →”System Properties”→”Device Manager” to make sure the device you install is correctly displayed. See Figure 4

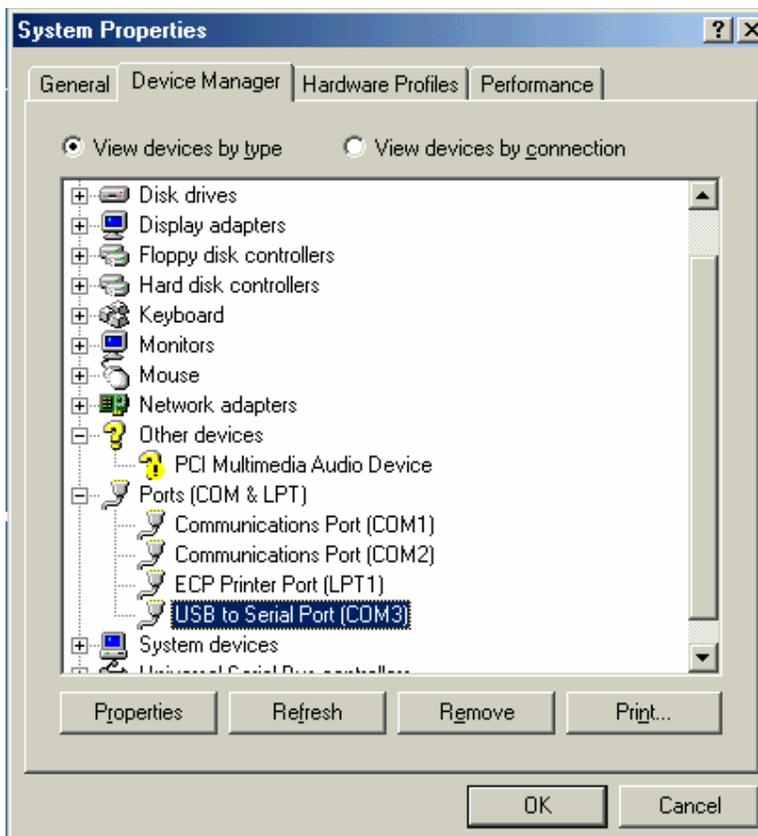


Figure 4